

Torque Sensor

Square, rotating, contactless

MODEL 8655



HighlightsMeasurem

- Measurement ranges of 0 ... 1 N·m to 0 ... 160 N·m
- Internal square and external square
- Very short design
- Output signal 0 ... ±10 V

Options

- Speed and angle measurement with resolution of up to 400 increments
- USB port including software

Applications

- Monitoring and regulation of screwing processes
- Quality monitoring of tools and machines
- Machinery and plant engineering



Small measuring range



Large measuring range

Product description

The compact torque sensor model 8655 with standard square is contactless constructed. The torque is recorded by the torsion of the shaft using the strain gage principle. Thanks to the inductive and optical transmission of the signals, the sensor is maintenance-free, the signals are digitized directly on the shaft and made available by the evaluation electronics as a voltage signal or via USB. The direction of rotation can be seen from the potential of the output voltage, clockwise rotation corresponds to positive output voltage, counterclockwise rotation the voltage level is negative.

The standard square enables simple integration into existing systems or devices, additional components such as couplings are not require.


To record the speed and angle of rotation, the sensor can optionally be equipped with an incremental disc with 400 increments. This speed / angle signal is available as a TTL output signal.

The free DigiVision software is available in connection with USB, alternatively drivers for LabVIEW and DASYLab are ready for download.

Connection cables in various lengths, metal bellows couplings and mounting brackets are available for integration in customer-specific systems.

Technical Data

8655	-	5001	5002	5005	5012	5025	5050	5063	5100	5160		
Measuring range calibrated in N·m from 0		±1 N·m	±2 N⋅m	±5 N⋅m	±12 N⋅m	±25 N⋅m	±50 N⋅m	±63 N·m	±100 N·m	±160 N·n		
Accuracy												
Relative non-linearity		0.25 % F.S.										
Relative hysteresis			0.05 % F.S.									
Tolerance of sensitivity			0.25 % F.S.									
Electrical values												
Rated supply voltage range	Э	10 30 V DC (or 5 V via USB)										
DC power consumption						approx. 2 W	/					
Output voltage at ± rated torque						±10 V						
Output resistance						1 kΩ						
Insulation resistance						$> 5 M\Omega$						
Update rate						400/sec.						
Ripple						$< 50 \text{ mV}_{ss}$						
Control signal						10.00 V DC	•					
Environmental cond	itions											
Range of operating and nominal temperature		0 °C +60 °C										
Sensitivity of temperature effects					on the zero	point 0.01 sitivity 0.01	5 % F.S./K 5 % F.S./K					
Mechanical values												
Dynamic overload safe					recommende	d 70 % of n	ominal torqu	е				
Max. operation torque					120 %	of nominal	torque					
Breakaway torque					300 %	of nominal	torque					
Alternating load					70 %	of nominal	torque					
Maximum limit axial load	[N]		7	0			150		10	65		
Maximum limit radial load	[N]	5	10	13	20	2	5	25	50	65		
Spring constant	[N·m/rad]	30	00	10	000	5000				000		
Mass moment of inertia measuring side	[10 ⁻⁶ kg*m ²]		3.	50			7.10		21	.50		
Mass moment of inertia drive side	[10 ⁻⁶ kg*m ²]	1.0 1.05 8.50 34.00							.00			
Max. rotary speed	[min ⁻¹]					3000						
Other												
Material			Н	ousing: mad	de of anodize	ed aluminiun	n; Shaft: stee	l shell 1.454	42			
Protection class		acc. EN 60529, IP40										
Weight	[g]		3	10			450		7.	50		
Installation												
Installation instructions		Do not exceed the permitted axial and radial forces during fitting and operation. Please refer to our operating instructions for detailed information www.burster.com.										

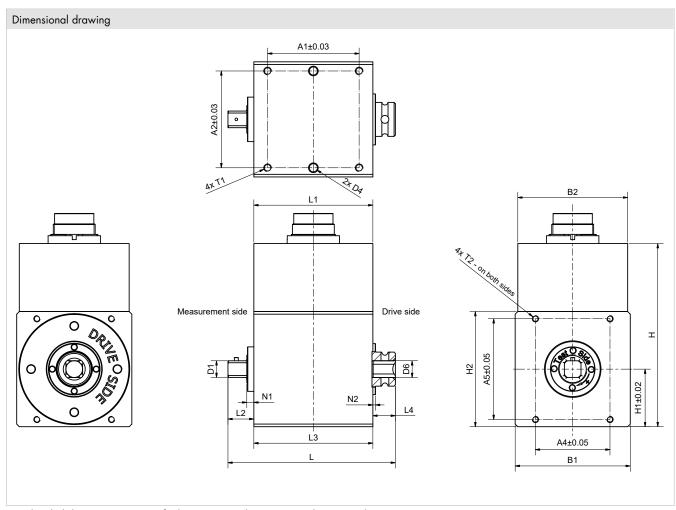

For detailed dimensions you can find sensor CAD data on our website www.burster.com.

8655	-	5001	5002	5005	5012	5025	5050	5063	5100	5160	
Measuring range from 0		±1 N⋅m	±2 N⋅m	±5 N⋅m	±12 N⋅m	±25 N⋅m	±50 N⋅m	±63 N⋅m	±100 N·m	±160 N⋅m	
Geometry											
A1	[mm]				35			33.5			
A2	[mm]		3	7			36	41			
A4	[mm]		28	3.5		44			50		
A5	[mm]		38	3.5			41	48			
B1	[mm]		4	4			50	59			
B2	[mm]					42					
D1	[mm]			nal square 21 form E			external squ N 3121 forr	½" external square DIN 3121 form E			
D6 / deep	[mm]	½" internal square DIN 3121 form H, 8 mm			3%" DIN 31:	internal squ 21 form H, 1	½" internal square DIN 3121 form H, 16.5 mm				
D4 Ø / deep	[mm]					Ø 3.1 / 6					
H1	[mm]		2	2		25			29.5		
H2	[mm]		4	4		50			59		
L	[mm]		64			71.10			89.4		
L2	[mm]	9.9			13.5			17.90			
L3	[mm]	45.5			47.5						
L4	[mm]	8.6			10.1			24			
T1 / deep	[mm]	M3 / 7									
T2 / deep	[mm]	M2.5 / 8					M3 / 8	M4 /8			

Electrical values

12-pin connector or USB connection for configuration / measurement (option, USB connection cable included)

Wiring Code depends on	the options selected	
Pin	Assignment	Cable colour (99540-000F-052XXXX)
A	NC	
В	Angular exit B	violet
С	Moment output +	yellow
D	Moment output -	green
Е	Supply -	blue
F	Supply +	red
G	Angular exit A	pink
Н	NC	
J	Ground angle output	black
K	Control signal	white
L	NC	brown
М	NC	

Options

Integrated amplifier with USB interface




This sensor version has an USB connection instead of the $\pm 10~\text{V}$ output. The sensor is powered via USB, no further connections required.

In addition to torque, the speed or rotation angle measured values are optionally available at the output. The mechanical performance calculated in the sensor can also be displayed using the DigiVision

Free drivers are available for integration into LabVIEW and DASYLab, also a DLL for integration into your own programs.

Torque sensor with integrated rotational speed / angular displacement measurement

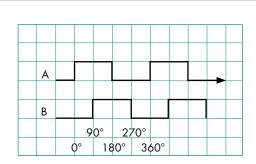

8655 torque sensors are optionally available with integrated rotational speed and angular displacement measurement. Two pulse channels with TTL level – channel A and channel B – are always available. For clockwise rotation (looking at the test side), channel A leads channel B with a phase shift of 90°. Only one pulse channel is needed for speed measurement.

For angular displacement measurement (or direction detection), both channels need to be evaluated. To achieve the maximum angular resolution, four-edge decoding must be used to read both the rising and falling edges, so an angular resolution of 0.255 $^{\circ}$ is possible.

Accessories

Mounting block model 8600-Z02X




The mounting block has a central hole and special design allowing a range of options for reliable cable attachment. Two clips ensure the sensor is fixed securely.


For further information please see accessories data sheet 8600-Z02X

DigiVision configuration and analysis software

Features

- Can be used to actuate tare function
- Configuration options for averaging and filters
- Intuitive user interface
- Automatic sensor identification
- Sensor calibration data readout

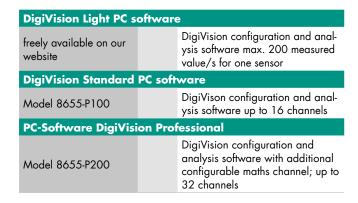

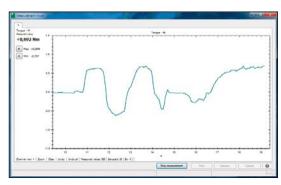

USB measurement option

- Numerical & graphical display and measurement of the physical torque value
- Practical start and stop trigger functions
- 4 limits can be configured for each measurement channel
- MIN/MAX value acquisition
- Automatic scaling
- Measurement reports can be saved as Excel or PDF file
- Archive viewer for displaying sets of curves
- X Multichannel measurements, even with different sensors (e.g. 9206, 8631, 8625, 8661) available with standard version

Accessories

Order code	
9940	Mating connection 12 pin (scope of delivery)
9900-V539	Mating connection 90°-angle
99540-000F-0520030	Connecting cable, length 3 m, other end free
99539-000F-0520030	Connecting cable, length 3 m, plug with 90°-angle, other end free
99209-540G-0160030	Connecting cable for model 7281 and model 9311, length 3 m, with external supply
99163-540A-0150030	Connecting cable, length 3 m, 8655 to DIGIFORCE® 9307combined cannel D (option channel)
99209-215A-0090004	Adapter cable to DIGIFORCE® 9307 standard channel A/B and C (usable only in connection with type 99163-540A-015xxxx)
	DigiVision Light configuration and analysis software, max. 200 measured value/s for one sensor (freely available on our website)
9900-K349	USB cable, length 2 m (included with the USB version)
8655-P100	DigiVision Standard configuration and analysis software; up to 16 channels
8655-P200	DigiVision Professional with additional configurable maths channel; up to 32 channels
8600-Z02X	Mounting block, see accessories data sheet 8600-Z02X

Calibration

Manufacturer Calibration Certificate (WKS)									
Special calibration for clockwise or/and counter clockwise direction torque, in 20 % steps of range up and dow									
DAkkS Calibration Certificate									
		DAkkS calibration certificate per DIN 51309, clockwise or/and counter clockwise torque, with eight steps spaced across the measurement range, increasing and decreasing.							

Order Code

Measuring Range		Co	de								
0 ±1 N·m	5	0	0	1							
0 ±2 N·m	5	0	0	2							
0 ±5 N⋅m	5	0	0	5							
0 ±12 N·m	5	0	1	2							
0 ±25 N⋅m	5	0	2	5							
0 ±50 N·m	5	0	5	0							
0 ±63 N⋅m	5	0	6	3							
0 ±100 N·m	5	1	0	0							
0 ±160 N·m	5	1	6	0				Stan	dard		
							0	0	0	- 1	
8 6 5 5 -					-	V	0			1	
					,						
■ Without angle/speed measurement 0											
Speed/angle measurement 400 increments											
Output signals											
Output voltage 0 ±10 V									0		
■ USB interface									1		
■ Internal square and external square	e acc. D	N 3121								1	